

TOSHIBA HALL SENSOR GaAs ION IMPLANTED PLANAR TYPE

THS122

HIGH STABILITY MOTOR CONTROL. DIGITAL TACHOMETER.

CRANK SHAFT POSITION SENSOR.


- Super Small Package.
- Excellent Temperature Characteristics.
- Wide Operating Temperature Range. (: $-55\sim 125^{\circ}\text{C}$)
- Excellent Output Voltage Linearity.
- High Specific Sensitivity. : $K^*=38\times 10^{-2}/T$ (Typ.)

MAXIMUM RATINGS ($T_a = 25^{\circ}\text{C}$)


CHARACTERISTIC	SYMBOL	RATING	UNIT
Control Current	DC	10**	mA
	1s	15**	
Power Dissipation	P_D	100**	mW
Operating Temperature Range	T_{opr}	$-55\sim 125$	$^{\circ}\text{C}$
Storage Temperature Range	T_{stg}	$-55\sim 150$	$^{\circ}\text{C}$

** Mounted on a printed circuit board.

Marking

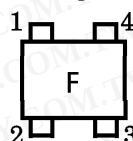

Unit in mm

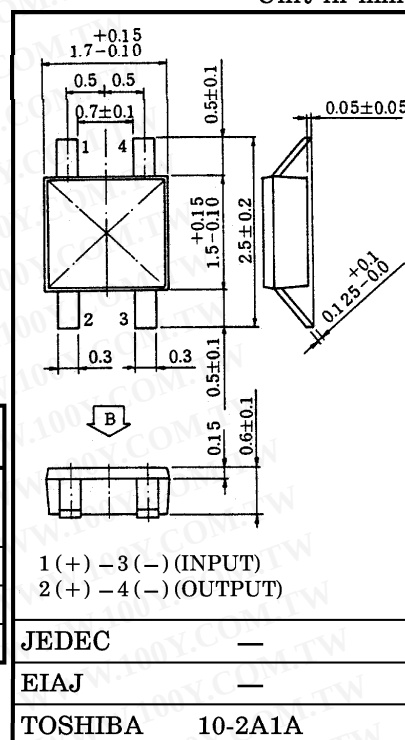ELECTRICAL CHARACTERISTICS ($T_a = 25^{\circ}\text{C}$)

CHARACTERISTIC	SYMBOL	TEST CONDITION	MIN.	TYP.	MAX.	UNIT
Internal Resistance (Input)	R_d	$I_C = 5\text{mA}$	450	—	900	Ω
Residual Voltage Ratio	V_{HO}/V_H	$I_C = 5\text{mA}$, $B = 0/B = 0.1\text{T}$	—	—	± 10	%
Hall Voltage (Note 1)	V_H	$I_C = 5\text{mA}$, $B = 0.1\text{T}$	80	—	190	mV
Temperature Coefficient (Note 2)	V_{HT}	$I_C = 5\text{mA}$, $B = 0.1\text{T}$ $T_1 = 25^{\circ}\text{C}$, $T_2 = 125^{\circ}\text{C}$	—	—	-0.06	%/ $^{\circ}\text{C}$
Linearity (Note 3)	ΔK_H	$I_C = 5\text{mA}$, $B_1 = 0.05\text{T}$, $B_2 = 0.1\text{T}$	—	—	2	%
Specific Sensitivity (Note 4)	K^*	$I_C = 5\text{mA}$, $B = 0.1\text{T}$	—	38	—	$\times 10^{-2}/T$
Internal Resistance (Output)	R_{OUT}	$I_C = 1\text{mA}$	—	—	3200	Ω







Note 1 : $V_H = V_{HM} - V_{HO}$ (V_{HM} is meter indication)Note 2 : $V_{HT} = \frac{1}{V_H(T_1)} \cdot \frac{V_H(T_2) - V_H(T_1)}{T_2 - T_1} \times 100 (\%/^{\circ}\text{C})$ V_{HO} : Residual VoltageNote 3 : $\Delta K_H = \frac{K_H(B_2) - K_H(B_1)}{1/2 \{ K_H(B_1) + K_H(B_2) \}} \times 100 (\%)$, $K_H = \frac{V_H}{I_C \cdot B}$ K_H : Product SensitivityNote 4 : $K^* = V_H / (R_d \times I_C \times B) = K_H / R_d$

961001EAA2

● TOSHIBA is continually working to improve the quality and the reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to observe standards of safety, and to avoid situations in which a malfunction or failure of a TOSHIBA product could cause loss of human life, bodily injury or damage to property. In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent products specifications. Also, please keep in mind the precautions and conditions set forth in the TOSHIBA Semiconductor Reliability Handbook.

勝特力材料 886-3-5753170
 勝特力电子(上海) 86-21-54151736
 勝特力电子(深圳) 86-755-83298787
[Http://www.100y.com.tw](http://www.100y.com.tw)

1997-08-18 1/2

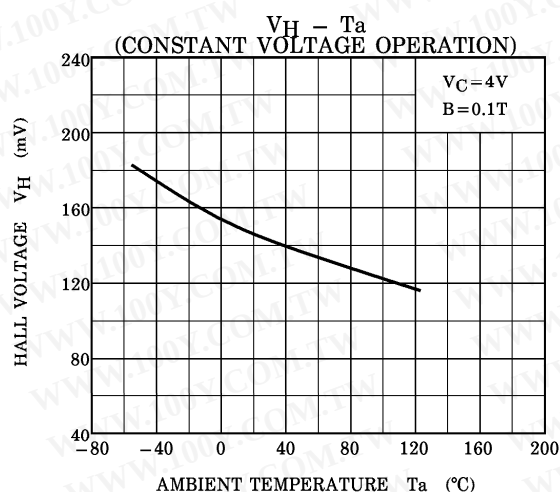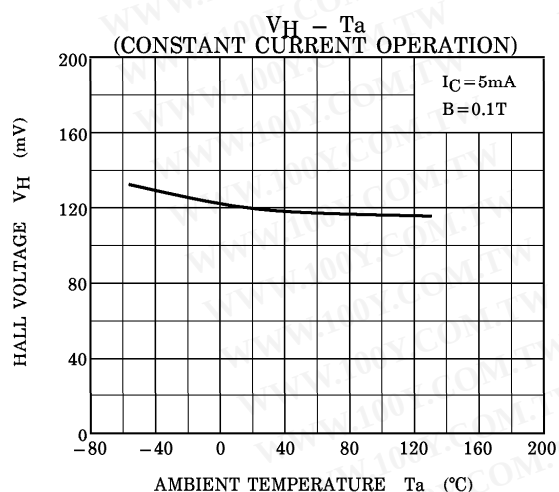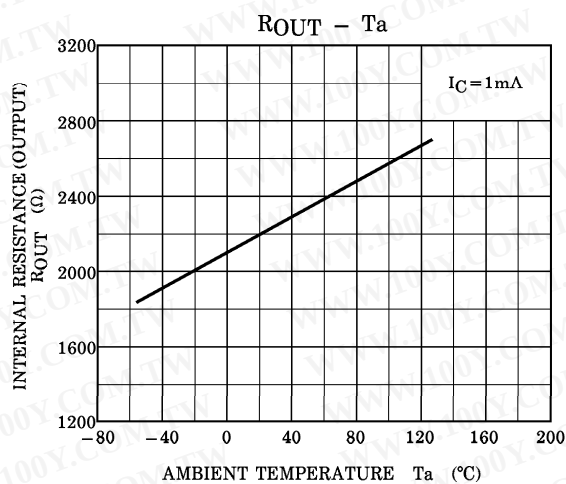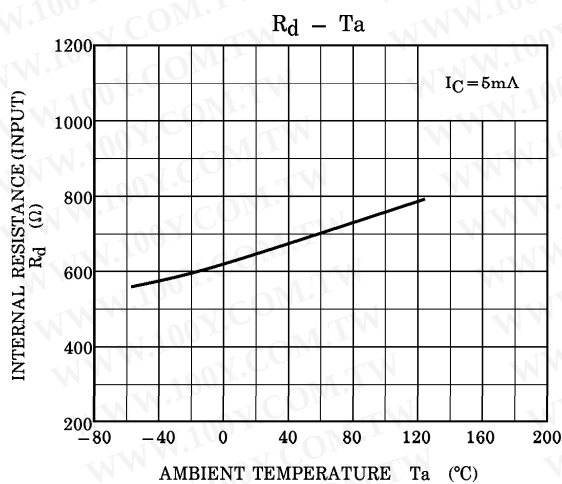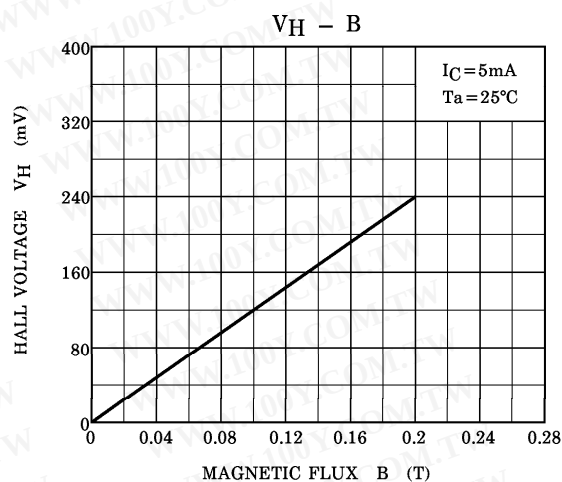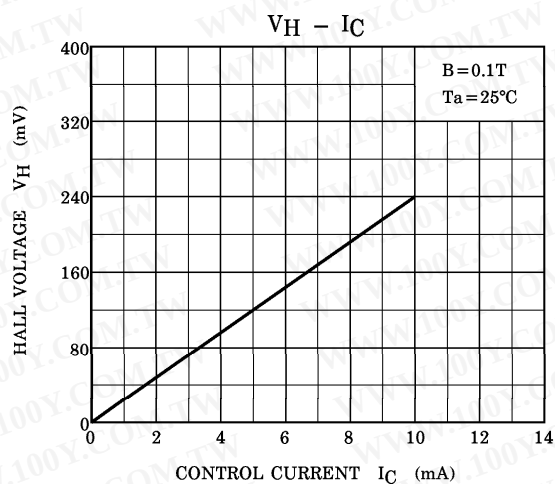

961001EAA2'

- The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others.
- The information contained herein is subject to change without notice.